


Crimp-On Procedure For BNC & TNC Connectors




1) Trim Cable as shown.

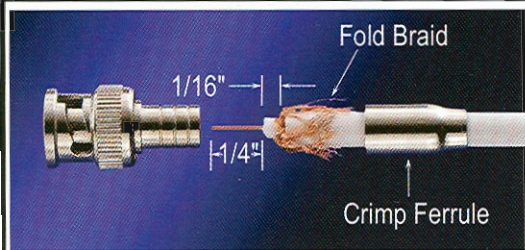

2) Slide crimp ferrule onto cable.


3) Fold braid back and complete trimming the cable as shown. Trim center conductor end at a 45° angle.

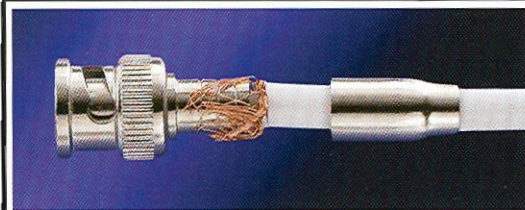

4) Push connector onto cable.

5) Fold braid back over crimp body.

6) Push crimp ferrule up over braid and crimp body.

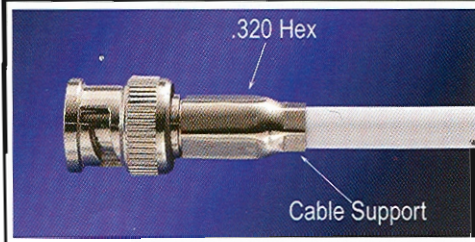

7) Using universal crimp tool P/N GET-301-UT, crimp ferrule to connector using .320 hex.

8) Crimp cable support with appropriate hex:
.264 RG6PVC - .250 RG59 PVC, RG6 TFE -
.212 RG59TFE, RG58PVC